



Fitting Instructions

YewdaleKestrel[®]

Anti-Ligature Window Curtain Tracks
(K6200)

Part no: 926


What you'll need




Screwdriver



Drill

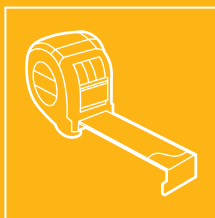


Measuring Tape

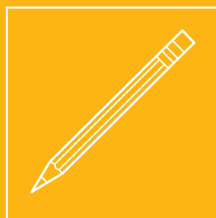


Pencil

What's in the box

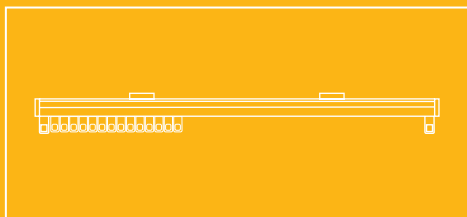


Pre-assembled Track


Face Fix Bracket

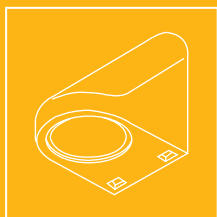

Magnet Housing

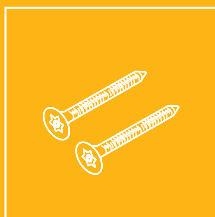


Fixing Screws

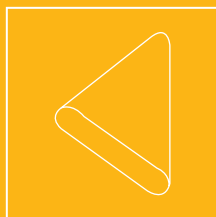


Screw Cover


Top Fix Bracket

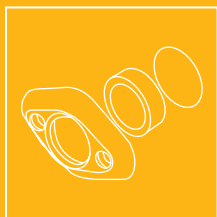

Magnet Housing

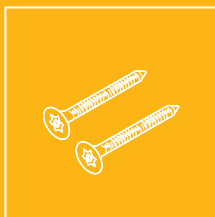

Fixing Screws

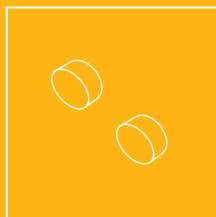

Screw Cover



Warning


All instructions must be read before installing.



Fitting Time

Approx. 10 - 20 minutes

depending on fixing substrate/length of track/height of fixing

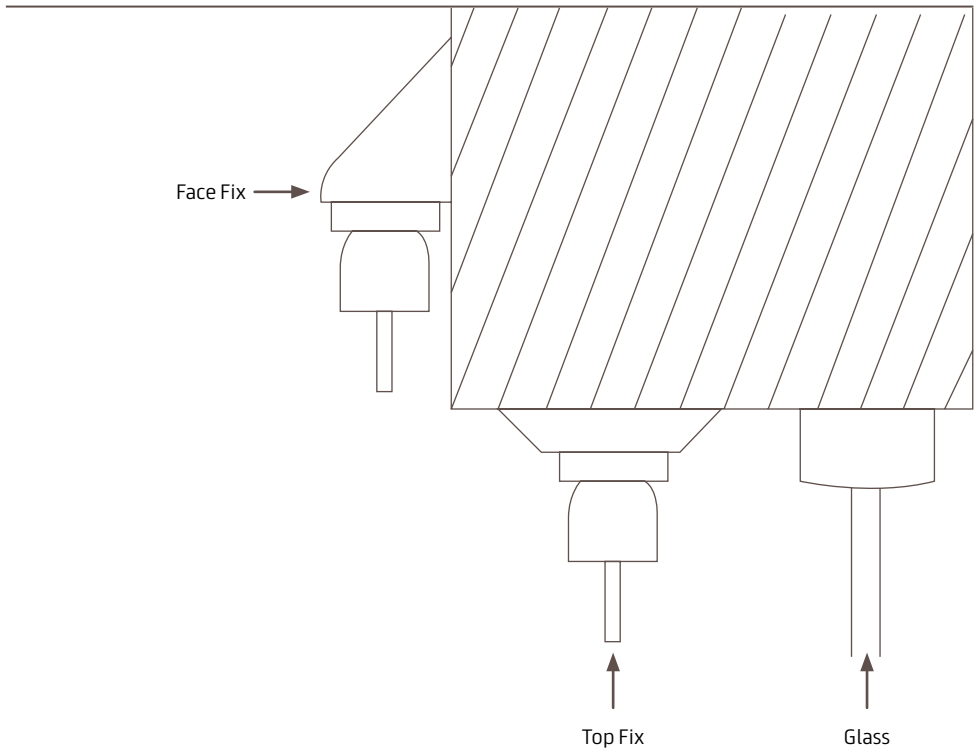


Anti-Ligature Window Curtain Tracks

Instructions - Face Fix


Before Installation

Check height and position of track ensuring the curtain will hang correctly and that no obstructions will prevent the track from collapsing.


- 01** All tracks come pre-assembled with discs, fitted to the track. Mark the position of the brackets using the centre of the disc.

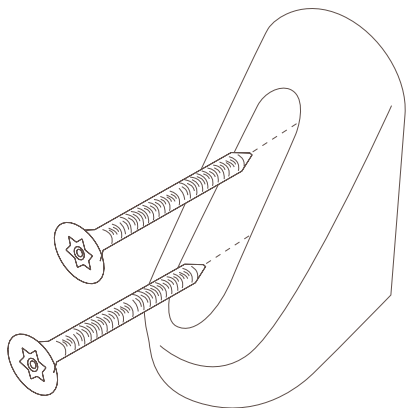


- 02** Ensure that the screw is not raised above the bracket body.

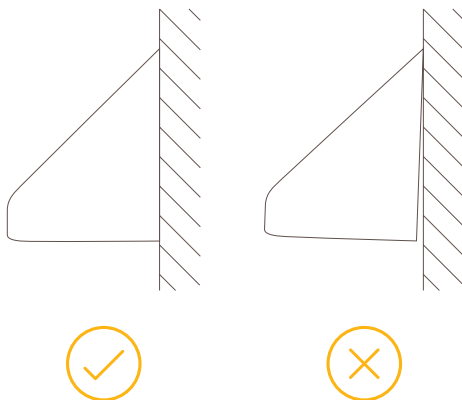

- 03** Push screw covers MUST be fitted ensuring that it is flush with the bracket body.

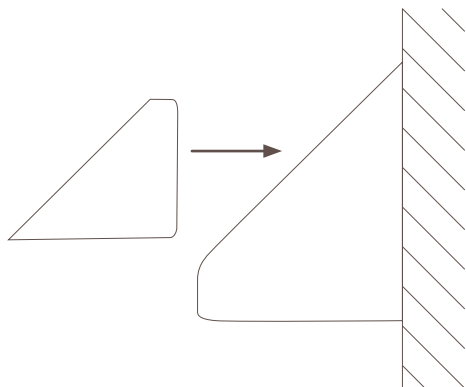

- 04**

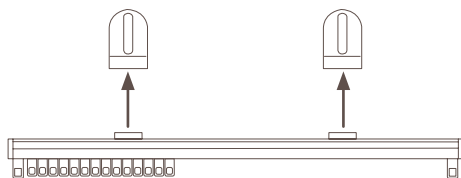

Magnetic discs are positioned 100mm from each end and a maximum of 1000mm between each magnetic disc.


Anti-Ligature Window Curtain Tracks

Instructions - Top Fix


Before Installation

Check height and position of track ensuring the curtain will hang correctly and that no obstructions will prevent the track from collapsing.


- 01** All tracks come pre-assembled with discs, fitted to the track. Mark the position of the brackets using the centre of the disc.

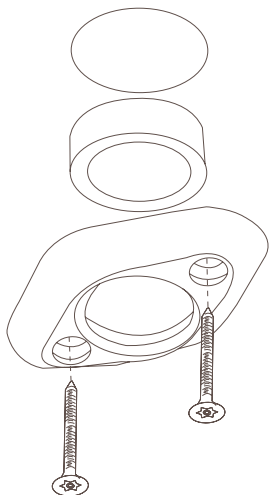


- 02** Ensure that the screw is not raised above the bracket body.

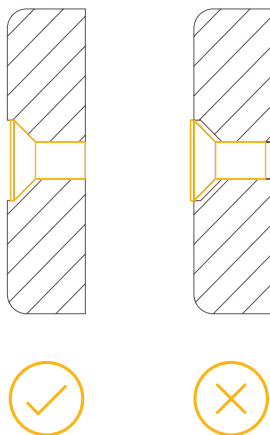

- 03** Push screw covers MUST be fitted ensuring that it is flush with the bracket body.

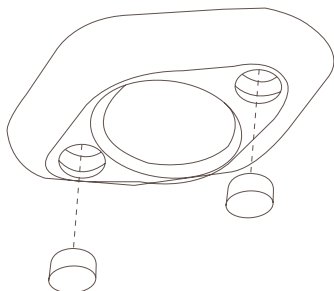

- 04**

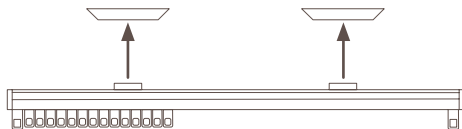

Magnetic discs are positioned 100mm from each end and a maximum of 1000mm between each magnetic disc.

Anti-Ligature Window Curtain Tracks

Testing

Testing







Discs should be horizontal and centre of gravity of load should be directly beneath centre-line of discs. Test completed installation. The downward force needed to part the brackets should never be more than 400N (40kg static load) at any point.

Please Note

Care must be taken to ensure that no ligature points are left once the installation has been completed. The push-in screw cover is intended to be tight fit to prevent unauthorized access to fixings.

YewdaleKestrel® Packers (K557PC)

If needed, YewdaleKestrel® Packers (K557PC) can be used. Do Not use any other items to replicate this.

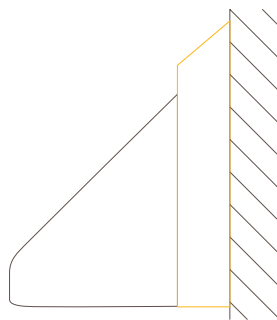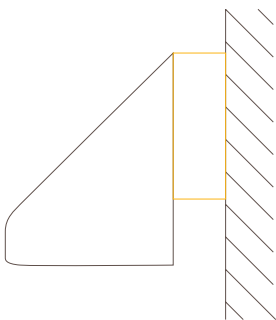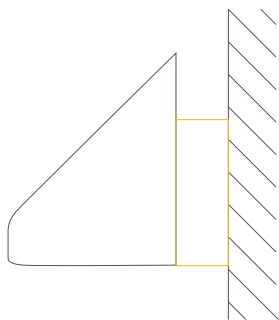

Anti-Ligature Window Curtain Tracks

Warning

The magnetic element of the YewdaleKestrel® bracket is POWERFUL. Handle with care. If attached to a flat steel surface it may be difficult to remove the magnet. DO NOT PLACE NEAR SENSITIVE ELECTRONIC EQUIPMENT.

YewdaleKestrel® products are designed as standalone products only. Care should be taken when assessing or arranging a room to ensure that YewdaleKestrel® products cannot be misused in conjunction with any other item, furniture or fixings in the room.

It is the responsibility of the end user or client to ensure the product is suitable for the environment it is being installed in. YewdaleKestrel® products must be fitted by a qualified professional with an up to date training certificate and in accordance with the manufacturer's instructions. Failure to do so could jeopardise the product's effectiveness as an anti-ligature system. All installations must be checked and commissioned on completion to ensure the downward forces does not exceed the maximum nor that it is breaking away below the normal force. It is highly recommended that sign off proof that the product is installed and commissioned correctly is issued to the client after installation.



For more information on installations, using the systems safely, load testing and maintenance, please scan the QR code to read our YewdaleKestrel® Policy.



Head Office:

Enterprise Way,
Wickford, Essex, SS11 8DH
Call: +44 (0)1268 570900
Email: sales@yewdale.co.uk

London Office & Showroom:

4 Sutton Lane,
London, EC1M 5PU
Call: +44 (0)203 818 5905

For more information on all
Yewdale products, please call
the sales department.

